


PART NO:	DESCRIPTION	QTY
XJTSC03139 (Pack of 10)	Verticasa Protection Cover Ext Plastic Cable Sponge Cable Ties (2.5x100mm)	1 2 2
XJTSC03140 (Pack of 10)	Verticasa Protection Cover Ext Plastic Case Sheath Self Fuse Tape Butile Sealing Strips Cable Ties (2.5x100m)	1 1 2 2

ADDITIONAL ACCESSORIES:	PART NO:
TBE-I2: Tapping Box Facade Inline 2 drops IP55 with trays (Pack of 10)	XJTSC03137
TBE-I2: Tapping Box Facade Inline 2 drops IP55 without trays (Pack of 10)	XJTSC03138
VERTICASA CABLE STRIPPING TOOL (VST)	XCPSC00567
VERTICASA STRIPPING TOOL COMPACT 2.0	XCPSC03277




OPENING A WINDOW IN THE CABLE

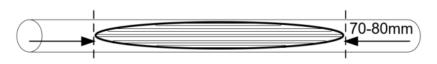


Open a 70-80mm window in the multi fibre cable using a recommended cable opening tool.

COVER CLOSURE

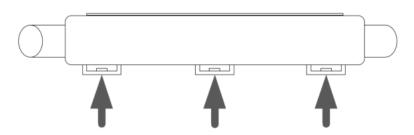

Close the cover by pressing by hand at the three locks. A "CLICK" should be heard when the clips move in position.

COVER OPENING

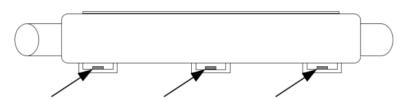


To open the cover, release the three clips by rotating a small screwdriver in the cut-outs inside the clips.

Alternatively, a tie wrap can be pushed in the cut-outs inside the clips and lever the clips.

(The release must be done at all three clips).

Page 2 of 11



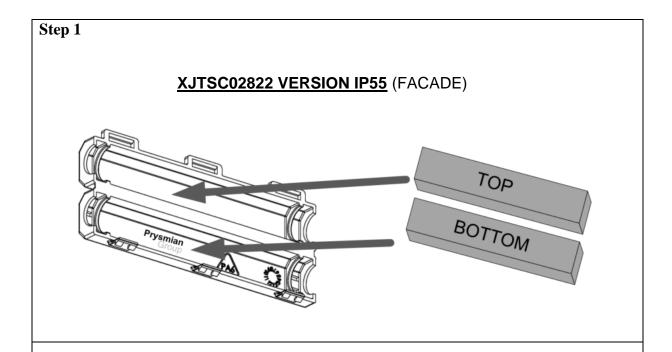

Insert the two rectangular foam blocks in the base and in the cover.

If cable Diameter is bigger than 11.5mm, DON'T INSTALL BOTTOM


FOAM.



Step 2		
	cable ties in the sides of the bead of the cable ties will fit inside the cover with the head of the cable ties will fit inside the cover with the head of the cable ties will fit inside the cover with the head of the cable ties will fit inside the cover with the head of the cable ties will fit inside the cover with the head of the cable ties will fit inside the cover with the head of the cable ties will fit inside the cover with the head of the cable ties will fit inside the cover with the head of the cable ties will fit inside the cover will be a supplied to the cover will b	

Page 4 of 11



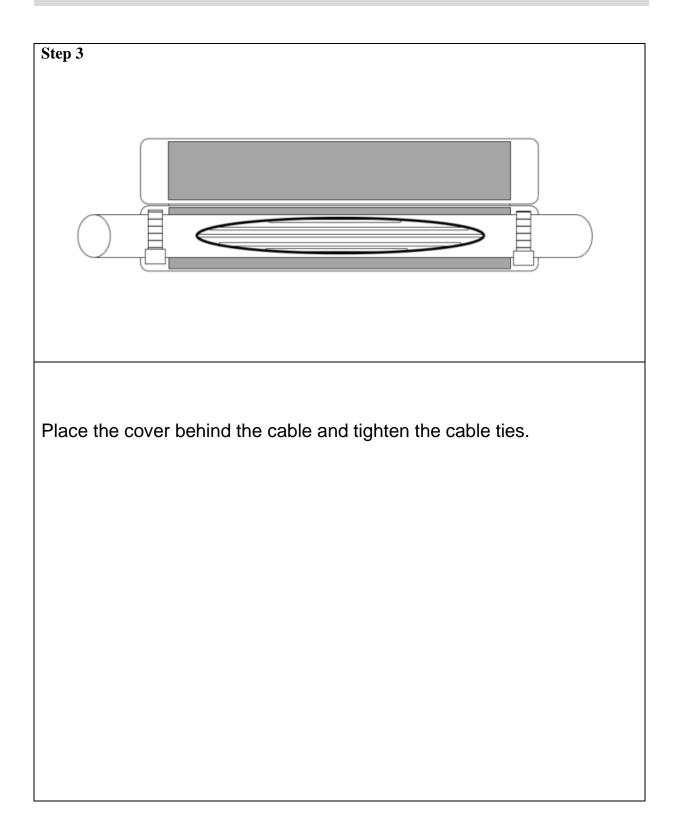


Page 5 of 11



Step 4
To close and re-open follow the instructions on the left column.


Page 6 of 11



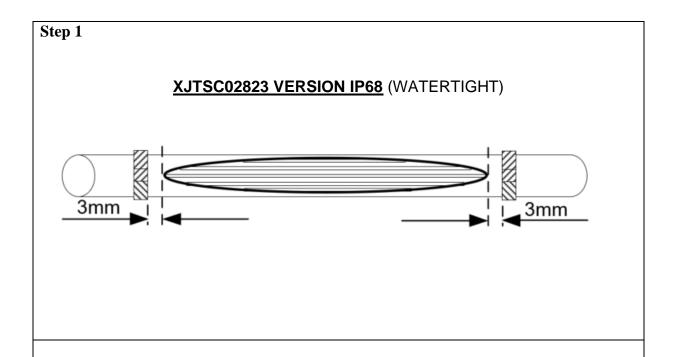

Apply the Butile Sealing Strips 3mm next to the cable window opening. Pay attention that the sealing strips make a complete turn around the cable with an overlap of at least 5mm.



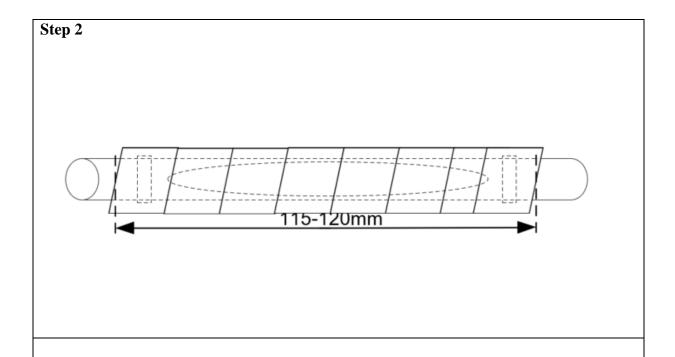


Apply the Sheath Self Fuse tape two times (forwards and backwards). The tape must be applied over a length of 115-120mm. Pay attention that the window opening of the cable is fully covered and the Butile sealing strips are centred under the looped tape.



Step 3				
	cable ties			
Check whether t closed.	he head of the	cable ties w	vill fit inside the	e cover when

Page 9 of 11



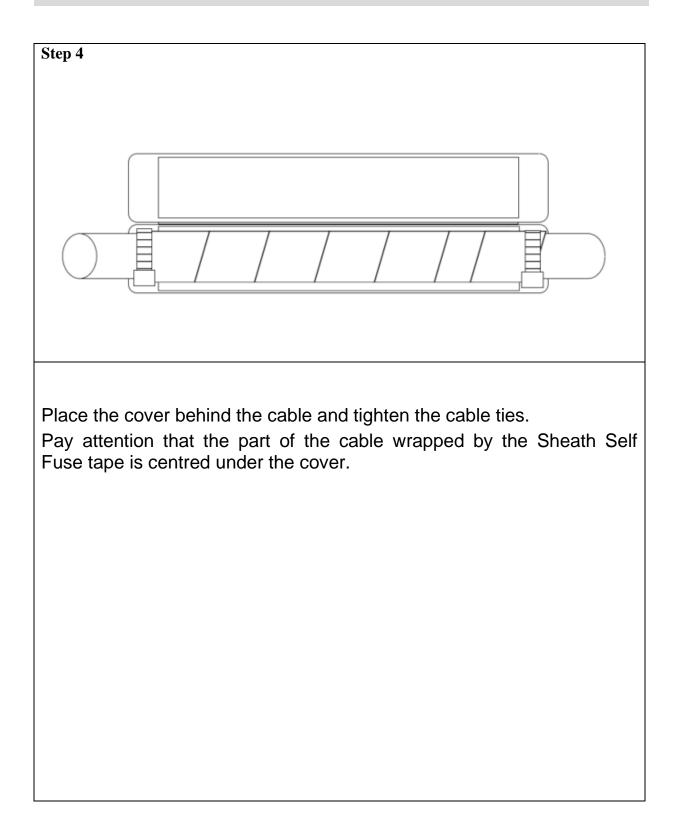

Page 10 of 11



Step 5
To close and re-open follow the instructions on the left column.
·
pyright Prysmian Group - 2023 You may not copy, reprint, or reproduce in any form the content, either

Copyright Prysmian Group - 2023 You may not copy, reprint, or reproduce in any form the content, either wholly or in part, of this Installation Guide, without the written permission of the copyright owner. Specifications are for product as supplied by Prysmian Group: any modification or alteration afterwards of product may give different result. The information is believed to be correct at the time of issue. Prysmian Group reserves the right to amend the information within this Installation Guide without prior notice. This Installation Guide may include inaccuracies, omissions of content and of information and is not contractually valundorised by Prysmian Group. Property of Prysmian Group UK - Uncontrolled when printed Prysmian Cables & Systems Limited, Chickenhall Lane, Eastleigh, Hampshire, SO50 6YU, United Kingdom.

Date: 05th January 2023 IP500 Issue Number: 03